

Sloan

Sloan Act-O-Matic Showerhead




AC-11-2.0 **88100619**
Self-cleaning chrome plated showerhead with thumb screw volume control and universal ball joint. Pressure compensating 2.0 gpm/7.5 Lpm maximum flow control. All brass construction. 1/2" I.P.S. inlet.



AC-51 **99311291**
Self-cleaning chrome plated showerhead without (less) thumb screw volume control and universal ball joint. Pressure compensating 2.5 gpm/9.4 Lpm maximum flow control. All brass construction. 1/2" I.P.S. inlet.



AC-11 **99030286**
Self-cleaning chrome plated showerhead with thumb screw volume control and universal ball joint. Pressure compensating 2.5 gpm/9.4 Lpm maximum flow control. All brass construction. 1/2" I.P.S. inlet.

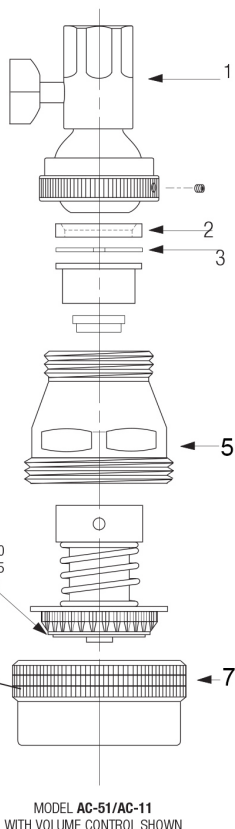

- | | | |
|---|----------|---|
| 1 | 88095920 | Ball Joint Coupling w/ Volume Control (CP) |
| | 99080055 | Ball Joint Coupling L/ Volume Control |
| 2 | 99153460 | 2.0 Gallon Flow Control Assembly |
| 3 | 99311549 | SH-3 Gasket (24/pkg) |
| | 99064343 | Single Gasket |
| 5 | 99080053 | Body |
| | 99311550 | Piston Assembly - Needle Spray, 2.5 GPM Piston & Gasket (1 & 3) |
| 7 | 99340955 | Coupling Ring |
| | 88093233 | Shower Body Assembly (2 & 7 on chart) (CP) |

99272918 Repair Kit for Needle Spray Showerhead (Includes items 2-5)

FLOW CONTROL MODEL CONVERSION

To convert an older Act-O-Matic showerhead to a flow control model, use repair kit **99272918**. Repair Kit contains gasket (item 2), piston assembly – needle spray (item 4) and coupling ring – needle spray (item 5).

NEEDLE SPRAY

NOTE: To properly repair an Act-O-Matic showerhead, it is important to identify needle spray part designs. Shower heads with 3 gpm (11 Lpm) or 2.5 gpm (9.4 Lpm) flow controls produced since 1985 use needle spray piston assembly and a needle spray coupling ring. Needle spray shower heads can be identified by the following: coupling ring ~~99340955~~ has groove on knurled diameter; plus an "N" marked on the back of the black spray disc in the piston assembly. When repairing an Act-O-Matic shower head with a flow control it is important to identify whether the part is of the needle spray design.

Needle Spray Repair Kits

99010949 Needle Spray Showerhead Repair Kit (Includes 1-4, shown to the right)

For Sloan Act-O-Matic model 100 series shower-heads (discontinued in 1970) use piston assembly SH-1003-A and SH-2-N.

